



Dryers



Trockner

Deshydrateur

Deshidratantes

Essiccatori

Osuszacze

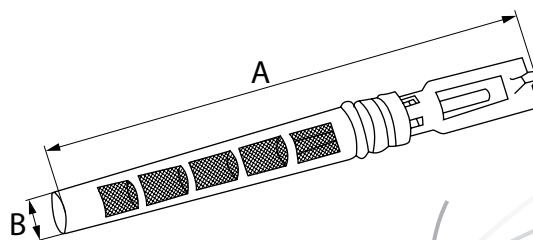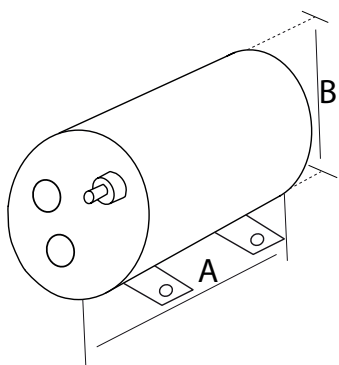

Edition 2021/2023





260102 Dryer

Replacing: 1015001010, 351192381, 8D0820193, 945016, DFD02008, 33131, 509501, 83501, 8FT351192-381, 931097

Servicing: Audi

Inlet M28-1.50 mm, **Outlet** M28-1.50 mm,
Refrigerant R134 a, **Filling valve** w/o

A: 282.00 **B:** 89.00 mm



260103 Dryer

Replacing: 01130332, 1062340, 1107450, 1120012, 1120030, 1130332, 1320500, 945125, DFD10009, TSP0175212

Servicing: Ford Australia

Inlet PAD/20.60 mm, **Outlet** Pad/14.60 mm,
Refrigerant R134a, **Filling valve** w/

A: 203.00 **B:** 89.00 mm



260104 Dryer

Replacing: 1015001021, 1121714, 1138446, 1152362, 1197811, 1307761, 1A7H19E647AH, 1S7H16E647AF, 1S7H19E647AA

Servicing: Ford Australia

Inlet 20.40 mm, **Outlet** 23.80 mm,
Refrigerant R134a, **Filling valve** w/

A: 219.00 **B:** 89.00 mm



260105 Dryer

Replacing: 1015001024, 1148792, 1148935, 1209041, 2S6H19E647AA, 2S6H19E647AB, 2S6H19E647AC, 2S6H19E647AD

Servicing: Ford Australia

Inlet 20.50 mm, **Outlet** 20.70 mm,
Refrigerant R134a, **Filling valve** w/

A: 200.00 **B:** 88.00 mm



260106 Dryer

Replacing: 1015001033, 1223457, 1231435, 1232435, 1354643, 1354646, 1363741, 1466549, 1478879, 1514518

Servicing: Changan Ford Mazda

Inlet 17.60 mm, **Outlet** 17.60 mm,
Refrigerant R134a, **Filling valve** w/o

A: 203.00 **B:** 89.00 mm



260107 Dryer

Replacing: 0175016, 1618013, 52461632, 52464310, 945283, 13740018, 33054, 33950, 508740, 7110190

Servicing: Opel

Inlet 8.60 mm, **Outlet** M18x1.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 178.00 **B:** 76.00 mm



260108 Dryer

Replacing: 09117400, 1618150, 59365, 90559848, 9117400, 931243, 931244, 945277, 13740175, 33711, 509400

Servicing: Holden

Inlet PAD/11.70 mm, **Outlet** Pad/8.80 mm,
Refrigerant R134a, **Filling valve** w/o

A: 110.00 **B:** 60.00 mm



260109 Dryer

Replacing: 13106001, 1618304, 9016404, 93177218, 945285, 33206, 7110185, 8FT351198-611, 931396, 95386

Servicing: Holden

Inlet 8.60 mm, **Outlet** 8.60 mm,
Refrigerant R134a, **Filling valve** w/o

A: 171.00 **B:** 55.00 mm



260110 Dryer

Replacing: 09165715, 1015001036, 1848000, 9165715, 945278, DFD20005, 33191, 509591, 7110131, 83910

Servicing: Holden

Inlet PAD/8.60 mm, **Outlet** pad/8.60 mm,
Refrigerant R134a, **Filling valve** w/o

A: 170.00 **B:** 55.00 mm



260111 Dryer

Replacing: 13128933, 1848049, 945284, 13750039, 33233, 509951, 83652, 8880700279, 8FT351200-341, 931368, 95437

Servicing: Opel

Inlet PAD/8.70 mm, **Outlet** PAD/8.70 mm,
Refrigerant R134a, **Filling valve** w/o

A: 164.00 **B:** 60.00 mm



260112 Dryer

Replacing: 1010001054, 1010001056, 64506917489, 6917489, 931347, 945465, JRJ100410, JTB100320, TSP0175350

Servicing: Mini

Refrigerant R134a, **Filling valve** w/o

A: 296.00 **B:** 45.00 mm



260113 Dryer

Replacing: 64538372978, 64538375757, 64538377330, 64538377332, 64538390342, 64538397523, 8375757, 8377330

Servicing: BMW

Inlet PAD/13.80 mm,
Outlet PAD/13.80 mm, **Refrigerant** R134a,
Filling valve w/o

A: 160.00 **B:** 64.00 mm



260114 Dryer

Replacing: 30645016, 30665072, 31101323, 351197571, 9166174, 945387, 13750057, 33121, 83810, 8880700198

Servicing: Volvo

Inlet PAD/10.20 mm, **Outlet** Pad/10.20 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 163.00 **B:** 60.00 mm



260115 Dryer

Replacing: 13148307, 1613808, 1618308, 931116, AF10056, DFD20017, 13750074, 33235, 509949, 7110129, 8880700254

Servicing: Chevrolet

Refrigerant R134a, **Filling valve** w/o

A: 336.00 **B:** 30.00 mm



260116 Dryer

Replacing: 0000060813064, 0000060815584, 0000082490764, 0046741664, 0060664995, 1761902, 20Y979320

Servicing: Fiat

Inlet PAD/10.20 mm, **Outlet** Pad/10.20 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 188.00 **B:** 60.00 mm



260117 Dryer

Replacing: 46745058, 945550, 13740099, 33152, 509589, 7110180, 83500, 88807000212, 8FT351189-141, 8FT351198141

Servicing: Fiat

Inlet PAD/10.20 mm, **Outlet** PAD/10.20 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 188.00 **B:** 60.00 mm

NEW PRODUCT

www.hc-cargo.com

260119* Dryer

Replacing: 2518350047, A2518350047

Inlet 11.10 mm, **Outlet** 11.10 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 400.00 **B:** 45.00 mm



260120 Dryer

Replacing: 0010028V002, 0010028V002000000, 2118350047, 2518350047, 260781, A2118350047, A2518350047

Servicing: Beijing Benz (BBDC)

Inlet 11.00 mm, **Outlet** 11.00 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 404.00 **B:** 45.00 mm



260122 Dryer

Replacing: 260123, 2764000QAB, 2764000QAC, 2764000QAE, 351197591, 7700836314, 7740836314, 945333, 13740120

Servicing: Renault

Inlet PAD/8.70 mm, **Outlet** Pad/8.70 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 246.50 **B:** 50.00 mm



260124 Dryer

Replacing: 8200025640, 931445, 945520, 13750070, 509727, 7110173, 83942, 8880700289, 8FT351192-401

Servicing: Renault

Inlet PAD/20.70 mm, **Outlet** Pad/20.70 mm, **Refrigerant** R134a, **Filling valve** w/

A: 215.00 **B:** 92.00 mm



260125 Dryer

Replacing: 8200052125, 8200071647, 8671017784, 9109618, 945530, DFD23018, TSP0175344, 33200, 83947, 931381

Servicing: Renault

Inlet PAD/11.00 mm, **Outlet** Pad/11.00 mm, **Refrigerant** R134a, **Filling valve** w/

A: 164.00 **B:** 60.00 mm



260126 Dryer

Replacing: 351197601, 7700436195, 8200112833, 13740113, 33120, 509500, 83510, 8FT351197-601, 931352, 95239

Servicing: Renault

Inlet PAD/11.00 mm, **Outlet** PAD/11.00 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 173.00 **B:** 60.00 mm



260127 Dryer

Replacing: 351198431, 64536907402, 6907402, 931434, 945438, 945439, 133750072, 33335, 7110201, 83751

Servicing: BMW

Refrigerant R134a, **Filling valve** w/o

A: 408.00 **B:** 37.00 mm



260128 Dryer

Replacing: 1015001035, 1C0820191, 1K0298403, 1K0298403A, 3C0898191B, 3C0898191C, 5C0298403, 931394, 931433

Servicing: VW

Inlet 12.10 mm, **Outlet** 12.30 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 350.00 **B:** 30.00 mm



260129 Dryer

Replacing: 260136, 351197761, 3B0820189, 3B0820191, 3B0820193, 3U0820193, 8E0820193C, 8E0820193R, 945020

Servicing: Audi

Inlet PAD/19.50 mm, **Outlet** Pad/19.50 mm,

Refrigerant R134a, **Filling valve** w/o

A: 205.00

B: 75.00 mm



260130 Dryer

Replacing: 351198731, 6455AH, 931329, 945301, DFD07004, E164152, E164255, TSP0175640M, 13750066, 33338, 509791

Servicing: Peugeot

Refrigerant R134a, **Filling valve** w/o

A: 347.50

B: 38.00 mm



260131 Dryer

Replacing: 6455CF, 6455EH, 945421, E164257, 13750073, 33343, 8880700255, 931405, 95404, CND225, DFD07012

Servicing: Citroen

Refrigerant R134a, **Filling valve** w/o

A: 340.00

B: 39.00 mm



260132 Dryer

Replacing: 6455CL, 6455FZ, 6455W8, 6460JW, 9635717280, VR-H2009-132BA, 13740205, 707148, 8880700231

Servicing: Peugeot

Inlet PAD / 8.70 mm, **Outlet** PAD/8,70 mm,

Refrigerant R134a, **Filling valve** w/o

Alternative no.: 261138

A: 170.00

B: 64.00 mm



260133 Dryer

Replacing: 260814, 351198451, 6Q0820193, 6Q0820193A, 6Q0820193, 7008689, 945337, 13740902, 33299, 7110159

Servicing: VW

Refrigerant R134a, **Filling valve** w/o

A: 343.00

B: 38.00 mm



260135 Dryer

Replacing: 351197701, 80101S0XA01, 80101-S7A-003, 8847408030, 8847422010, 88474-47010, 8847447020, 931407

Servicing: Toyota

Refrigerant R134a, **Filling valve** w/o

A: 235.00

B: 32.00 mm



260138 Dryer

Replacing: 921311DA0A, 921311DA1A, 921311DJ0A, 92131-4M420, 921316M010, 92131-AU420, 92131-BM405, 92131BM40A

Servicing: Nissan

Inlet 10.20 mm, **Outlet** 10.20 mm,

Refrigerant R134a, **Filling valve** w/o

A: 241.00

B: 40.00 mm



260139 Dryer

Replacing: 5M0298403, 64536905171, 64536918120, 64536936559, 64536942025, 6905171, 6918120, 6942025, 71737165

Servicing: Alfa Romeo

Refrigerant R134a, **Filling valve** w/o

A: 335.00

B: 30.00 mm



260141 Dryer

Replacing: 30612501, 30621525, 30621526, 30811998, 30882921, 30899717, 351195521, 931271, 931272, 931364

Servicing: Mitsubishi

Inlet PAD / 8.50 mm, **Outlet** Pad/8.50 mm,

Refrigerant R134a, **Filling valve** w/o

A: 170.00

B: 60.00 mm



260142 Dryer

Replacing: 0K56E-61500, 0K56E-61500A, 260955, 931417, 945469, 0K55261500A, 0K56E61500, 0K56E61500A, T301730080

Servicing: Kia

Inlet PAD/8.40 mm, **Outlet** Pad/8.40 mm,

Refrigerant R134a, **Filling valve** w/o

A: 221.00

B: 60.00 mm



260143 Dryer

Replacing: 945480, 96320092, 96512885, 96512886, DFD08002, P96512885, 13740185, 33149, 83550, 8FT351200-421

Servicing: Daewoo

Inlet PAD/8.60 mm, **Outlet** Pad/8.60 mm,

Refrigerant R134a, **Filling valve** w/o

A: 123.00

B: 60.00 mm



260144# Dryer

Replacing: 0175044, 351197331, 7700823668, 931050, 945587, 13740029, 508613, 7110462, 8FT351197-331, DFD23023

Servicing: Renault

Inlet PAD/8.60 mm, **Outlet** PAD/8,60 mm,

Refrigerant R134a, **Filling valve** w/o

A: 185.00

B: 64.00 mm



260147 Dryer

Replacing: 1004142, 1015001013, 1032630, 1032631, 1047779, 1095826, 1121178, 351192061, 931153, 945496

Servicing: Ford

Inlet 20.00 mm, **Outlet** 20.00 mm,
Refrigerant R134a, **Filling valve** w/o

A: 203.00

B: 89.00 mm



260153 Dryer

Replacing: 1H0820191, 1H0820191A, 1H0820193A, 351197561, 535820191A, 6K0820191, 7D1820191A, 931052, 931258

Servicing: VW

Inlet 5/8-18UNF, **Outlet** 3/4-16UNF,
Refrigerant R134a, **Filling valve** w/o

A: 177.00

B: 75.00 mm



260158# Dryer

Replacing: 4148300058, 4148300858, 931392, 945532, A4148300058, 33128, 509411, 8FT351198-501, 95232, MSD104

Servicing: Mercedes-Benz

Inlet PAD/11.10 mm, **Outlet** pad/11.10 mm,
Refrigerant R134a, **Filling valve** w/o

A: 130.00

B: 60.00 mm



260148 Dryer

Replacing: 1C0820191B, 1C0820191C, 1J0820191A, 1J0820191B, 1J0820191D, 1J0820191D, 351196391, 931095, 945408

Servicing: Faw-VW

Inlet PAD/13.00 mm, **Outlet** PAD/13.00 mm,
Refrigerant R134a, **Filling valve** w/o

A: 160.00

B: 60.00 mm



260154 Dryer

Replacing: 6X0820191, 6X0820191A, 6X0820191B, 931253, 931373, 945409, 945540, DFD32002, TSP0175665M, 13740218

Servicing: VW

Inlet PAD/13.50 mm, **Outlet** PAD/13.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 275.00

B: 40.00 mm



260159 Dryer

Replacing: 351198111, 6025311363, 6025315738, 7701045347, 931205, DFD23013, DFD23032, TSP0175259, 13740121

Servicing: Renault

Inlet PAD/11.00 mm, **Outlet** PAD/11.00 mm,
Refrigerant R134a, **Filling valve** w/o

A: 182.00

B: 60.00 mm



260150 Dryer

Replacing: 1848019, 351195361, 5037123184, 73031-AA010, 73031-AA011, 73410AC040, 8970956580, 9213153F00

Servicing: Nissan

Inlet PAD/9.40 mm, **Outlet** PAD/ 9.40 mm,
Refrigerant R134a, **Filling valve** w/o

A: 160.00

B: 60.00 mm



260155 Dryer

Replacing: 1393869, 64531393869, 64538353039, 64538372977, 64538391313, 8353039, 8372977, 8375754, 8391313

Servicing: BMW

Inlet PAD/13.70 mm, **Outlet** PAD/13.70 mm,
Refrigerant R134a, **Filling valve** w/o

A: 98.00

B: 100.00 mm



260160 Dryer

Replacing: 7D0820191, 931333, 931339, 931374, 945412, 13750081, 33192, 7110441, 8FT351200-351, 95342

Servicing: VW

Inlet PAD/9.35 mm, **Outlet** PAD/9.35 mm,
Refrigerant R134a, **Filling valve** w/o

A: 310.00

B: 40.00 mm



260152 Dryer

Replacing: 1848019, 1955784, 1959867, 5037123184, 73410AC030, 73410AC040, 8970492510, 8970956580, 92130-53B00

Servicing: Nissan

Inlet PAD/9.40 mm, **Outlet** PAD/9.40 mm,
Refrigerant R134a, **Filling valve** w/o

A: 165.00

B: 60.00 mm



260157 Dryer

Replacing: 1688300858, 4148300858, 931324, 931392, A1688300858, A4148300858, 13740172, 33128, 8FT351197-581

Servicing: Mercedes-Benz

Inlet PAD/11.10 mm, **Outlet** PAD/11.10 mm,
Refrigerant R134a, **Filling valve** w/o

A: 145.00

B: 60.00 mm



260163 Dryer

Replacing: 0K30C61500C, 0K30C61500D, 905530, 931366, 945516, 96539635, 96539636, 97801-FDA00, 0K30C61500C

Servicing: Chevrolet

Inlet PAD/8.50 mm, **Outlet** PAD/8.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 248.00

B: 40.00 mm



260164 Dryer

Replacing: 351197701, 80101-SAA-003, 8010S-7A-003, 88474-17010, 8847422010, 931407, TSP0175351

Servicing: Toyota

Refrigerant R134a, **Filling valve** w/o

A: 216.00

B: 30.00 mm



260165 Dryer

Replacing: 1698300058, 931463, 946419, A1698300058, DFD17035, 13750089, 33282, 7110560, 8880700278

Servicing: Mercedes-Benz

Inlet PAD/11.10 mm, **Outlet** PAD/13.70 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 365.00

B: 45.00 mm



260166 Dryer

Replacing: 1698300083, A1698300083, 13750088, 33308, 8FT351335-271, 95487, MSD471

Servicing: Mercedes-Benz

Inlet 13.80 mm, **Outlet** 13.80 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 365.00

B: 45.00 mm



260168 Dryer

Replacing: 1618010, 1618042, 1618074, 1618154, 1618193, 52464426, 52464604, 52479126, 52482791, 5248310

Servicing: Holden

Inlet PAD/11.80 mm, **Outlet** PAD/8.60 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 173.00

B: 70.00 mm



260170 Dryer

Replacing: 0003435V003, 0003435V003000, 0003435V003000000, 2038350147, 351197711, 931410, A2038350147

Servicing: Smart (MCC)

Refrigerant R134a, **Filling valve** w/o

A: 370.00

B: 38.00 mm



260171# Dryer

Replacing: 09194971, 4703029, 9194971, 931369, 945445, 9533078F10, 33284, 8880700258, 8FT351200-381, OLD343

Servicing: Opel

Inlet PAD/10.20 mm, **Outlet** PAD/10.20 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 185.00

B: 30.00 mm



260172 Dryer

Replacing: 1015001008, 1015001009, 351192041, 4B0260774, 4B0820192, 4B0820193, 4B3820193, 4B820192, 4B820193

Servicing: SVW

Inlet M28 mm, **Outlet** M28 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 206.00

B: 88.80 mm



260173 Dryer

Replacing: 931338, 945452, 97801-02000, 13740188, 509891, 8880700225, 8FT351198-721, DFD41002, HYD080

Servicing: Hyundai

Inlet PAD/8.60 mm, **Outlet** PAD/8.60 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 190.00

B: 60.00 mm



260174 Dryer

Replacing: 1638300083, 931222, 945536, A1638300083, TSP0175355, 13750069, 33293, 8880700227, 8FT351200-311

Servicing: Mercedes-Benz

Inlet 10.30 mm, **Outlet** 10.30 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 163.00

B: 60.00 mm



260175# Dryer

Replacing: 1015001015, 1015001017, 1022556, 1055316, 1063920, 1077753, 1089203, 1089204, 1094957, 1097733

Servicing: Ford Australia

Inlet 19.60 mm, **Outlet** 19.60 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 203.00

B: 89.00 mm



260176 Dryer


Replacing: 92131-2X800

Servicing: Nissan

Inlet PAD/9.80 mm, **Outlet** PAD/9.80 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 165.00

B: 60.00 mm

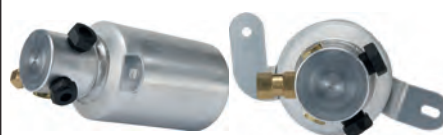

260180 Dryer

Replacing: 2028300083, 2028300283, 351196311, 931029, 931216, 945224, A2028300083, A2028300283, DFD17015

Servicing: Mercedes-Benz

Inlet 5/8-18 UNF, **Outlet** 5/8 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 175.00

B: 75.00 mm



260181 Dryer

Replacing: 351196461, 64538375754, 931083, 945056, 13740093, 33111, 509391, 7110238, 8880700163, 8FT351195-431

Servicing: BMW

Inlet PAD/13.70 mm, **Outlet** PAD/13.70 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 100.00 **B:** 100.00 mm



260182 Dryer

Replacing: 1151378, 1151398, 1338167, 1M212B912AA, 351197381, 4M212B912AA, 7M3820191, 7M3820749, 7M3820955

Servicing: VW

Refrigerant R134a, **Filling valve** w/o

A: 305.00 **B:** 39.00 mm



260183 Dryer

Replacing: 351195751, 7004385, 7230473, 7H0820191A, 7M0820191A, 931077, 945124, 95VW19959AB, DFD10011, 7110240

Servicing: Ford

Inlet PAD/8.70 mm, **Outlet** PAD/8.70 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 168.00 **B:** 75.50 mm



260184 Dryer

Replacing: 3A0820191, 3A0820191C, 3A0820191D, 931056, 945415, DFD32008, 13740084, 33071, 508605, 7110370

Servicing: VW

Inlet 3/4-16UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a, **Filling valve** w/o

A: 186.50 **B:** 75.00 mm



260250 Dryer

Replacing: 46481438, 46533979, 46802605, 46827086, 867107SA, 931281, 945161, DFD09004, TSP0175409, 13740146

Servicing: Fiat

Inlet 10.10 mm, **Outlet** 10.10 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 187.00 **B:** 60.00 mm



260251 Dryer

Replacing: 946446, BBM4-61-501, GJ6A-61-501, GJ6A-61-501A, 33302, 8FT351197-741, MZD234

Servicing: Mazda

Inlet PAD/8.90 mm, **Outlet** PAD/8.90 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 280.00 **B:** 35.00 mm




260252 Dryer

Replacing: 1618051, 1618074, 52464604, 52466909, 52484310, 52484345, 52485121, 90512213, 931037, 931327

Servicing: Opel

Inlet PAD/8.60 mm, **Outlet** PAD/11.80 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 173.00 **B:** 70.00 mm

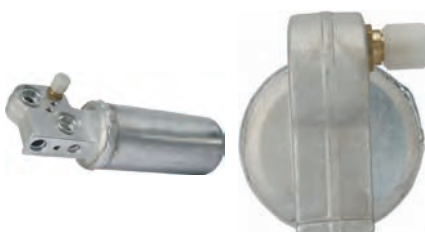

260253# Dryer

Replacing: 7701038394, 931048, 945334, 13740024, 33056, 508623, 7110382, 8880700126, 8FT351195-551, 95037

Servicing: Renault

Inlet PAD/12.10 mm, **Outlet** PAD/8.60 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 224.00 **B:** 65.00 mm



260255# Dryer

Replacing: 1015001012, 1015001044, 1027047, 1038408, 1073278, 1079278, 1094660, 1105794, 1113786, 1123296

Servicing: Ford Australia

Inlet 16.80 mm, **Outlet** 14.40 mm, **Refrigerant** R134a, **Filling valve** w/

A: 203.00 **B:** 90.00 mm



260256 Dryer

Replacing: 351196101, 6453KF, 6453V1, 931079, 945300, 96194566, 9619456680, E164225, 33077, 508872, 7110235

Servicing: Peugeot

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a, **Filling valve** w/

A: 160.00 **B:** 74.00 mm



260257 Dryer

Replacing: 95339-58J00, 95351, DFD50002, SZD096

Servicing: Suzuki

Refrigerant R134a, **Filling valve** w/o

A: 216.00 **B:** 30.00 mm



260258 Dryer

Replacing: 0000060802053, 260118, 46723358, 46811665, 51733521, 60802053, 60805053, 71740363, DFD09015

Servicing: Fiat

Refrigerant R134a, **Filling valve** w/o

A: 300.00 **B:** 29.00 mm



260259 Dryer

Replacing: 64536936557, 6936557, 931453, 946428, TSP0175407, 33312, 509935, 8880700270, 8FT351192-531, 95466

Servicing: BMW

Refrigerant R134a, **Filling valve** w/o

A: 380.00 **B:** 30.00 mm



260261 Dryer

Replacing: 80351SDAA01, 80351-SDC-A01, 80351-SED-003, 931415, 946433, A0351SED0031, TSP0175364, 33300, 7110491

Servicing: Honda

Inlet 7.50 mm, **Outlet** 7.50 mm,

Refrigerant R134a, **Filling valve** w/o

A: 271.00 **B:** 35.00 mm



260262 Dryer

Replacing: 80351-SMG-E01, 80351-SMG-E02, 946434, 33285, 8FT351193-191, HDD230

Servicing: Honda

Inlet PAD/10.10 mm,

Outlet PAD/10.10 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 165.00 **B:** 40.00 mm



260263 Dryer

Replacing: 5001875483, 6455FK, 73412-FE000, 7815A285, 80351SJD003, 921312Y900, 92131-2Y920, 92131-2Y960

Servicing: Subaru

Inlet PAD/10.20 mm,

Outlet PAD/10.20 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 235.00 **B:** 40.00 mm



260264 Dryer

Replacing: 1618371, 93188634, 946440, 13750095, 7110423, 8880700305, 95455

Servicing: Opel

Refrigerant R134a, **Filling valve** w/o

A: 232.00 **B:** 30.00 mm



260265 Dryer

Replacing: 97801-3E000, 978E05, TSP0175447, 13750031, 509945, 8FT351193-291, 95484, KAD165

Servicing: Kia

Inlet PAD/9.10 mm, **Outlet** PAD/9.10 mm,

Refrigerant R134a, **Filling valve** w/o

A: 245.00 **B:** 40.00 mm



260266 Dryer

Replacing: 351198691, 97133-2H500, 97133-2L000, 971332L000AT, 97802-17000, 97802-25000, 978022H000, 978023L000

Servicing: Hyundai

Refrigerant R134a, **Filling valve** w/o

A: 240.00 **B:** 17.00 mm



260268 Dryer

Replacing: 351198461, 3C0898191, 931411, 945599, 13750037, 33328, 7110361, 8FT351192-561, 95358, DFD17021

Servicing: VW

Refrigerant R134a, **Filling valve** w/o

A: 350.00 **B:** 29.00 mm



260269 Dryer

Replacing: 09109618, 2764000QAA, 4401618, 8200119657, 931384, 945530, DFD23018, DFD23020, TSP0175344

Servicing: Vauxhall

Inlet 11.10 mm, **Outlet** 11.10 mm,

Refrigerant R134a, **Filling valve** w/o

A: 165.00 **B:** 60.00 mm



260270 Dryer

Replacing: 8847497203, 88578B1140, 95339-63J00, 8FT351200-391, DUD061

Servicing: Suzuki

Refrigerant R134a, **Filling valve** w/o

A: 235.00 **B:** 35.00 mm



260271 Dryer

Replacing: 2108300083, 2108300183, 2108300383, 7004347, 931030, 931217, A2108300083, A2108300183, A2108300383

Servicing: Mercedes-Benz

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,

Refrigerant R134a, **Filling valve** w/o

A: 172.00 **B:** 74.00 mm



260272 Dryer

Replacing: 2108300083, 2108300283, 2108300483, 7004347, 931030, 931217, 945217, A2108300083, A2108300283

Servicing: Mercedes-Benz

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,

Refrigerant R134a, **Filling valve** w/o

A: 170.00 **B:** 74.00 mm



260274# Dryer

Replacing: 6455P8, 931014, 945066, 945073, 9610829080, TSP0155162, 13740021, 33046, 508738, 7110472

Servicing: Citroen

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a, **Filling valve** w/o

A: 176.00

B: 76.00 mm



260279 Dryer

Replacing: 351195701, 4230462, 4868949, 7496847, 924270, 931213, 931214, 945340, TSP0175164, 13740118, 33130

Servicing: Saab

Inlet 8.50 mm, **Outlet** 8.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 167.00

B: 70.00 mm



260283 Dryer


Replacing: 260137, 351197771, 4F0820189D, 4F0820191, 4F0820191A, 4F0820191B, 8E0260800, 8E0820193E, 8E0820193F

Servicing: Audi

Inlet PAD/20.50 mm, **Outlet** PAD/20.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 205.00

B: 76.00 mm

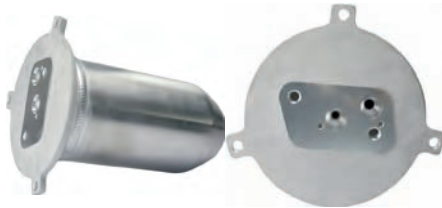

260275 Dryer

Replacing: 64528372985, 64538372985, 64538375760, 64538379523, 64538391793, 8372985, 8375760, 8379523, 8391793

Servicing: BMW

Inlet PAD/13.90 mm, **Outlet** PAD/13.90 mm,
Refrigerant R134a, **Filling valve** w/o

A: 190.00

B: 89.00 mm



260280 Dryer

Replacing: 06561590, 1132757, 2764000Q0A, 2764000QAD, 4408038, 8200004174, 91166604, DFD23033, 13750076, 33318

Servicing: Renault

Inlet PAD/20.70 mm, **Outlet** PAD/20.70 mm,
Refrigerant R134a, **Filling valve** w/o

A: 200.00

B: 91.00 mm



260284 Dryer

Replacing: 05058013AA, 05058015AA, 05058015AB, 5017441AA, 5017442AA, 5058013AA, 5058325AA, 5096289AA

Servicing: Chrysler

Inlet 18.20 mm, **Outlet** 18.20 mm,
Refrigerant R134a, **Filling valve** w/o

A: 190.00

B: 89.00 mm



260276 Dryer

Replacing: 1848045, 1848046, 24418370, 24418371, 33202, 8FT351197-641, 95409, V40-06-0026

Servicing: Saab

Inlet 8.70 mm, **Outlet** 8.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 156.00

B: 60.00 mm



260281 Dryer

Replacing: 09151057, 4500757, 7700752840, 7700766344, 7700775150, 7700841978, 912930, 9151057, 9161057, 931046

Servicing: Renault

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a, **Filling valve** w/o

A: 195.00

B: 63.00 mm



260285 Dryer

Replacing: 351196721, 6455W1, 6455X8, 931249, 931279, 945299, 961082980, 9635501980, 97701-05500, E164017

Servicing: Citroen

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a, **Filling valve** w/o

A: 126.00

B: 59.00 mm



260278 Dryer

Replacing: 1015001006, 3C1H19E647AA, 4042676, 4053339, 4510765, 931330, 945584, DFD10023, TSP0175219

Servicing: Ford

Inlet PAD/17.80 mm, **Outlet** PAD/17.80 mm,
Refrigerant R134a, **Filling valve** w/

A: 215.00

B: 89.00 mm



260282 Dryer

Replacing: 04682592, 04682623, 4682592, 4682623AB, 931113, 931113A, 945474, DFD06007, JK04682592AB, TSP0175196

Servicing: Chrysler

Inlet PAD/8.70 mm, **Outlet** PAD/11.80 mm,
Refrigerant R134a, **Filling valve** w/o

A: 170.00

B: 60.00 mm



260287 Dryer

Replacing: 06571325, 1140168, 2764000QAD, 4416936, 8200468518, 93856084, DFD23033, 33317, 7110287, 8880700276

Servicing: Renault

Inlet PAD/21.30 mm, **Outlet** PAD/21.30 mm,
Refrigerant R134a, **Filling valve** w/o

A: 200.00

B: 92.00 mm



260288 Dryer

Replacing: 351196331, 931334, 945106, 96160606, 96225633, DFD08001, TSP0175106, TSP0175291, 13740183, 33148

Servicing: Daewoo

Inlet 11.70 mm, **Outlet** 11.70 mm,

Refrigerant R134a, **Filling valve** w/o

A: 149.00

B: 60.00 mm



260294 Dryer

Replacing: 5N0298403, 13750100, 33297, 7110398, 8880700298, 8FT351200-261, 95453, VWD297

Servicing: VW

Inlet 12.30 mm, **Outlet** 12.30 mm,

Refrigerant R134a, **Filling valve** w/o

A: 228.00

B: 35.00 mm



260299 Dryer

Replacing: 2208300083, 830014, 931225, 945221, 9700300283, 9708300083, 9738300083, A2208300083, A9700300283

Servicing: Mercedes-Benz

Inlet PAD/13.80 mm, **Outlet** PAD/13.80 mm,

Refrigerant R134a, **Filling valve** w/o

A: 208.00

B: 65.00 mm



260290 Dryer

Replacing: 0000051750398, 13115040, 13167341, 1848051, 1848052, 51779931, 71740473, 931450, 945597, 13750082

Servicing: Opel

Inlet PAD/8.70 mm, **Outlet** PAD/8.70 mm,

Refrigerant R134a, **Filling valve** w/o

A: 156.00

B: 60.00 mm



260295 Dryer

Replacing: 611658, 611856, 613166, 613499, 931334, 931440, 931448, 94225633, 96190606, 96207355, DFD08001

Servicing: Daewoo

Inlet PAD/11.80 mm, **Outlet** PAD/11.80 mm,

Refrigerant R134a, **Filling valve** w/o

A: 150.00

B: 60.00 mm



260300# Dryer

Replacing: 92100BM400, 92130-4M400, 921304Z000, 921306M000, 921314M470, 921316M010, 921316M070, 92139-6M000

Servicing: Nissan

Inlet PAD/10.20 mm, **Outlet** PAD/10.20 mm,

Refrigerant R134a, **Filling valve** w/o

A: 140.00

B: 60.00 mm



260292 Dryer

Replacing: 0021590V001000000, 7L0898151A, 7L0898191, 7L0898191A, 931419, 945585, 95557314300, 95557314301

Servicing: VW

Refrigerant R134a, **Filling valve** w/o

A: 389.00

B: 29.00 mm



260296 Dryer

Replacing: 8K0298403, 8K0298403B, 8T0298403, 13750091, 33310, 8FT351200-271, 95450, 95451, AID298, TSP0175439

Servicing: Audi

Inlet 12.30 mm, **Outlet** 12.30 mm,

Refrigerant R134a, **Filling valve** w/o

A: 285.00

B: 30.00 mm



260301 Dryer

Replacing: 92131-2F000, 921312F010, 921312F011, 92131-2F600, 921312F611, 931358, 931378, 931393, DFD46002

Servicing: Nissan

Inlet PAD/10.00 mm, **Outlet** PAD/10.00 mm,

Refrigerant R134a, **Filling valve** w/o

A: 155.00

B: 60.00 mm



260293 Dryer

Replacing: 80350S6DE21, 80351S01A01, 80351S01A11, 80351-S04-003, 80351-S04-901, 80351S1AG01, 80351S1BG01

Servicing: Honda

Inlet PAD/10.10 mm,

Outlet PAD/10.10 mm, **Refrigerant** R134a,

Filling valve w/o

A: 163.00

B: 60.00 mm



260298 Dryer

Replacing: 2D0820191, 351196251, 9015500180, 931259, 931323, 945220, A9015500180, DFD17019, TSP0175063, 33231

Servicing: VW

Inlet 5/8 - 18 UNF, **Outlet** 5/8 - 18 UNF,

Refrigerant R134a, **Filling valve** w/o

A: 175.00

B: 75.00 mm



260302 Dryer

Replacing: 921310V510, 921310V570, 921310V571, 92131-9F500, 921319F700, 9213289914, 931380, 945547, DFD46003

Servicing: Nissan

Inlet PAD/10.20 mm, **Outlet** PAD/10.20 mm,

Refrigerant R134a, **Filling valve** w/o

A: 150.00

B: 60.00 mm



260303# Dryer

Replacing: D651-61-501, 13750102, 33225, TOD017, V38-06-0012

Servicing: Mazda

Inlet PAD/8.50 mm, **Outlet** PAD/8.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 170.00 **B:** 45.00 mm



260304 Dryer

Replacing: 6455Q7, 931011, 945072, 96176820, 9617682080, E164163, 13740034, 33047, 508741, 7110252, 8880700066

Servicing: Peugeot

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a, **Filling valve** w/o

A: 176.00 **B:** 76.00 mm



260305 Dryer

Replacing: 97801-2E000, 13750020, 7110411, 8880700274, 8FT351200-711, HYD218, TSP0175411, V52-06-0014

Servicing: Hyundai

Inlet PAD/8.50 mm, **Outlet** PAD/8.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 210.00 **B:** 45.00 mm



260306# Dryer

Replacing: 931322, 945577, DFD11019, XR854220, XR88040, XW4H19959, XW4H19959BB, 13750022, 33156, 509944

Servicing: Jaguar

Inlet 7.50 mm, **Outlet** 7.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 111.00 **B:** 76.00 mm



260308 Dryer

Replacing: 931319, AWR1374, 33161, 509690, 7110313, 8880700211, 8FT351195-651, 95223, AUD144, DFD14002

Servicing: Land Rover

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a, **Filling valve** w/o

A: 230.00 **B:** 63.00 mm



260309 Dryer

Replacing: 931297, 931337, 931362, 945250, BJ3D-61-500A, BK2J61500A, E01661500, EA0161500, GE4T-61-500A

Servicing: Mazda

Inlet PAD/8.50 mm, **Outlet** PAD/8.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 162.00 **B:** 60.00 mm



260311 Dryer

Replacing: 1015001022, 1X4H19E647AB, 260310, 351335001, 931390, 945615, C2S4732, C2S6013, VP1X4H19E647AB

Servicing: Jaguar

Inlet 23.80 mm, **Outlet** 20.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 235.00 **B:** 89.00 mm



260317 Dryer

Replacing: JRJ500020, 33304, 8FT351193-541, AUD216

Servicing: Land Rover

Inlet PAD/10.20 mm,
Outlet PAD/10.20 mm, **Refrigerant** R134a,
Filling valve w/o

A: 281.00 **B:** 40.00 mm



260318# Dryer

Replacing: 931363, 945426, NC10-61-500, NC10-61-500A, 33333, 8880700216, 8FT351200-771, 95364, MZD149

Servicing: Mazda

Inlet M16-1.50 mm, **Outlet** M16-1.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 210.00 **B:** 64.00 mm



260319 Dryer

Replacing: 4042105, UH71-61-500B, 95377

Servicing: Mazda

Inlet PAD/8.50 mm, **Outlet** PAD/8.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 149.00 **B:** 60.00 mm



260320 Dryer

Replacing: 1848006, 1848038, 1848039, 351197571, 7812A095, 921312F011, 921312J905, 931438, 945387, 945448

Servicing: Holden

Inlet PAD/10.00 mm, **Outlet** PAD/10.00 mm,
Refrigerant R134a, **Filling valve** w/o

A: 163.00 **B:** 60.00 mm



260322 Dryer

Replacing: 351198451, 6Q0820193B, 6QE820193, 7008689, 945337, 13740902, 509594, 8880700291, 8FT351197-251

Servicing: Skoda

Refrigerant R134a, **Filling valve** w/o

A: 355.50 **B:** 30.00 mm



260323 Dryer

Replacing: 1015001001, 1015001002, 1015001003, 12586700, 3445554, 351192021, 3545554, 35455542, 9134705

Servicing: Volvo

Inlet 17.50 mm, **Outlet** 7/8 - 14UNF,
Refrigerant R134a, **Filling valve** w/o

A: 208.00 **B:** 89.00 mm



260325 Dryer

Replacing: 1618395, 93188638, DFD09012, 13750096, 7110520, 8880700303, 95456, FTD343

Servicing: Opel

Refrigerant R134a, **Filling valve** w/o

A: 175.00 **B:** 25.00 mm



260326# Dryer

Replacing: 931366, 945516, 96539635, MR500038, OK30C61500C, OK30C61500D, 33230, 95426, DWD050

Servicing: Mitsubishi

Inlet PAD/9.00 mm, **Outlet** PAD/9.00 mm,
Refrigerant R134a, **Filling valve** w/o

A: 230.00 **B:** 40.00 mm



260327 Dryer

Replacing: 1015001032, 1211222, 1365483, 1365484, 1509857, 2T1H19E647AE, 2T1H19E647AF, 2T1H19E647AG

Servicing: Ford

Inlet 17.70 mm, **Outlet** 20.50 mm,
Refrigerant R134a, **Filling valve** w/

A: 203.00 **B:** 89.00 mm



260330# Dryer

Replacing: 18JRE500030, JRE500030, 7110249, 8FT351198-491

Servicing: Land Rover

Refrigerant R134a, **Filling valve** w/o

A: 430.00 **B:** 30.00 mm



260331 Dryer

Replacing: 92131-JD20A, 95445, DND285

Servicing: Nissan

Inlet 10.20 mm, **Outlet** 15.40 mm,
Refrigerant R134a, **Filling valve** w/o

A: 190.00 **B:** 50.00 mm



260335# Dryer

Replacing: 1131663, 351192161, 60806458, 60810151, 7603140, 82478871, 82478872, 931001, DFD01002, DFD01003

Servicing: Fiat

Inlet M27 mm, **Outlet** M27 mm,
Refrigerant R134a, **Filling valve** w/o

A: 202.00 **B:** 89.00 mm



260337 Dryer

Replacing: 1015001011, 4D0820193A, 931100, 945442, 13740159, 33132, 4D0820193A, 8880700162, 8FT351192-391

Servicing: Audi

Inlet M28-1.50 mm, **Outlet** M28-1.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 230.00 **B:** 89.00 mm



260775 Dryer

Replacing: 2048350147, 4H0298403, 7E0298403, A2048350147, 33350, 515277, 8880700297, 8FT351193-241, 95465

Servicing: Mercedes-Benz

Refrigerant R134a, **Filling valve** w/o

A: 365.00 **B:** 28.00 mm



260776 Dryer

Replacing: 7700436061, 931383, 946439, TSP0175676, TSP0175676M, 13740206, 33199, 509792, 95471, DFD23008

Servicing: Renault

Inlet 11.10 mm, **Outlet** 11.10 mm,
Refrigerant R134a, **Filling valve** w/o

A: 168.00 **B:** 62.00 mm



260778 Dryer

Replacing: 6455GN, 71749797, CND249, DFD07015

Servicing: Peugeot

Refrigerant R134a, **Filling valve** w/o

A: 305.00 **B:** 29.00 mm

NEW PRODUCT
www.hc-cargo.com

260779* Dryer

Replacing: 1015001306, 1534184, 7G9119B691AA, 7G9119B961AA, VP7EKH19B961AB, 13750087, 8880700319

Servicing: Ford



260780 Dryer

Replacing: 1015001302, 1498865, 1512673, 8V4119E647AB, 8V4119E647AC, VP8V4H19E647AB, 13750086, 8FT351335-261

Servicing: Ford

Inlet 17.60 mm, **Outlet** 17.60 mm,
Refrigerant R134a, **Filling valve** w/o
A: 202.00 **B:** 89.00 mm



260782 Dryer

Replacing: 1015001031, 351335041, 4158300400, 8200189627, 8200247360, 931412, 945529, A4158300400, TSP0175663M

Servicing: Renault

Inlet 20.60 mm, **Outlet** 20.60 mm,
Refrigerant R134a, **Filling valve** w/o
A: 204.00 **B:** 89.00 mm



260783 Dryer

Replacing: 351198461, 6398350547, A6398350547, 13750037, 33328, 8880700251, 8FT351198-461, 95358, MSD358

Servicing: Mercedes-Benz

Refrigerant R134a, **Filling valve** w/o
A: 350.00 **B:** 29.00 mm



260784 Dryer

Replacing: 1848044, 24418368, 71740528, 71746357, 871847W, 931356, 945598, DFD20010, 13740204, 33201, 509692

Servicing: Holden

Inlet 8.60 mm, **Outlet** 8.60 mm,
Refrigerant R134a, **Filling valve** w/o
A: 155.00 **B:** 60.00 mm




260785 Dryer

Replacing: 701820191, 701820191A, 701820191E, 7D0820191A, 7D1820191, 931277, 945410, 13740160, 33032

Servicing: VW

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a, **Filling valve** w/o
A: 133.00 **B:** 77.00 mm

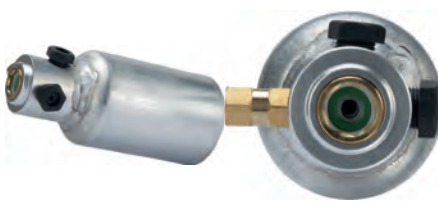

260787 Dryer

Replacing: 9015500080, 931226, 945225, A9015500080, 13740079, 33085, 509560, 8880700156, 8FT351196-241, 95229

Servicing: Mercedes-Benz

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a, **Filling valve** w/o
A: 175.00 **B:** 75.00 mm



260788 Dryer

Replacing: 64528372979, 64538368079, 64538372979, 64538378684, 64538379523, 8368079, 8372979, 8378684, 931075

Servicing: BMW

Inlet 13.80 mm, **Outlet** 13.80 mm,
Refrigerant R134a, **Filling valve** w/o
A: 200.00 **B:** 90.00 mm

NEW PRODUCT
www.hc-cargo.com

260790* Dryer

Replacing: 7700423936, 7700839787, 931070, 945331, TSP0175023, 13740063, 33086, 508624, 8880700128

Servicing: Renault



260792 Dryer

Replacing: 351192031, 4A0820191, 4A0820191AB, 4A0820193AB, 931076, 931091, 931092, 945018, DFD06005

Servicing: Audi

Inlet M28-1.50 mm, **Outlet** M28-1.50 mm,
Refrigerant R134a, **Filling valve** w/o
A: 230.00 **B:** 89.00 mm

NEW PRODUCT
www.hc-cargo.com

260793 Dryer

Replacing: 7701060041, 7701067998

Servicing: Renault

Inlet 10.15 mm, **Outlet** 10.15 mm,
Refrigerant R134a
A: 272.00 **B:** 40.00 mm



260794 Dryer

Replacing: 1618220, 92185JY00A, 931451, 93168073, 1700D315, 8880700342, 8FT351197-291, FTD315

Servicing: Fiat

Refrigerant R134a, **Filling valve** w/o
A: 233.00 **B:** 30.00 mm



260796 Dryer

Replacing: 8200352288, 946441, 13750041, 95470, DFD23009, RTD442, TSP0175419

Servicing: Renault

Inlet 10.90 mm, **Outlet** 10.90 mm,
Refrigerant R134a, **Filling valve** w/o
A: 170.00 **B:** 60.00 mm



260797 Dryer

Replacing: 64509237857, 64539127927, 64539202688, 64539237857, 81619106039, 9127927, 8880700301, 8880700302

Servicing: Mini

Refrigerant R134a, **Filling valve** w/o

A: 248.00 **B:** 24.00 mm



260798 Dryer

Replacing: 4E0820189G, 33334, 95433, AID348, V10-06-0033

Servicing: Mini

Inlet 20.50 mm, **Outlet** 20.50 mm,

Refrigerant R134a, **Filling valve** w/o

A: 180.00 **B:** 75.00 mm



260799# Dryer

Replacing: 1848047, 24454111, 931455, 946436, 8FT351192-511, 95410, OLD453

Servicing: Vauxhall

Inlet 8.60 mm, **Outlet** 8.60 mm,

Refrigerant R134a, **Filling valve** w/o

A: 155.00 **B:** 60.00 mm



260800# Dryer

Replacing: 0175010, 351198311, 6672268, 7067762, 7107568, 7170398, 92FG19959AA, 931062, 931144, 931283, 945493

Servicing: Ford

Inlet 5/8-18UNF, **Outlet** 5/8 - 18 UNF,

Refrigerant R134a, **Filling valve** w/

A: 197.00 **B:** 75.00 mm

NEW PRODUCT

www.hc-cargo.com

260802* Dryer

Replacing: 1435697, 6G9119B9612AA, 8880700317

Servicing: Volvo



260803 Dryer

Replacing: 1T0298403, 1T0820191A, 931433, 13750055, 33213, 8FT351200-161, DFD32006, TSP0175358

Servicing: VW

Inlet 12.30 mm, **Outlet** 12.30 mm,

Refrigerant R134a, **Filling valve** w/o

A: 382.00 **B:** 30.00 mm



260804 Dryer

Replacing: 6R0898191, 8X0898191, 8X0898191A, 13750104, 8880700322, STD043

Servicing: VW

Refrigerant R134a, **Filling valve** w/o

A: 325.00 **B:** 29.00 mm

NEW PRODUCT

www.hc-cargo.com

260805* Dryer

Replacing: 1666196, 8V5119B961AA, 8880700312

Servicing: Ford Australia



260807 Dryer

Replacing: 2E1820193A, 2E1820193C, 9068350047, A9068350047, DFD17034, 13750079, 33298, 7110558, 8880700293

Servicing: Mercedes-Benz

Inlet 11.10 mm, **Outlet** 11.10 mm,

Refrigerant R134a, **Filling valve** w/o

A: 295.00 **B:** 40.00 mm



260808 Dryer

Replacing: 92131-JD00A, 95444, DND282, V38-06-0013

Servicing: Nissan

Inlet 15.40 mm, **Outlet** 10.00 mm,

Refrigerant R134a, **Filling valve** w/o

A: 190.00 **B:** 50.00 mm



260809 Dryer

Replacing: 92131-JD50A, 92133JD50B, 95448, DND284

Servicing: Nissan

Inlet 15.50 mm, **Outlet** 10.15 mm,

Refrigerant R134a, **Filling valve** w/o

A: 378.00 **B:** 50.00 mm



260811 Dryer

Replacing: 80101SVAA01, MR500065, 33230, 8FT351200-371, 95406, MTD236, V37-06-0002

Servicing: Mitsubishi

Inlet 9.00 mm, **Outlet** 9.00 mm,

Refrigerant R134a, **Filling valve** w/o

A: 230.00 **B:** 40.00 mm



260812 Dryer

Replacing: 614719, 931424, 945519, 96405845, 13750011, 8FT351200-681, 95473, DWD057, TSP0175443, V51-06-0007

Servicing: Chevrolet

Inlet 11.80 mm, **Outlet** 11.80 mm,
Refrigerant R134a, **Filling valve** w/o
A: 220.00 **B:** 50.00 mm



260836 Dryer

Replacing: 14883340, 1488334080, 351197541, 6455A, 6455AJ, 6455AK, 6455CE, 931404, 945466, E164164, 13740135

Servicing: Peugeot

Refrigerant R134a, **Filling valve** w/o
A: 297.00 **B:** 45.00 mm



260837 Dryer

Replacing: 3C0898191A, 931411, 945599, 13750037, 8880700337, 8FT351192-571, MSD358

Servicing: VW

Refrigerant R134a, **Filling valve** w/o
A: 349.00 **B:** 29.00 mm



260839 Dryer

Replacing: 931297, B02H-61-500A, B02H-61-500B, B02H-61-500C, B02H-61-500D, B02H61500Z, B33D-61-500A, BJ3D61500

Servicing: Mazda

Inlet 8.50 mm, **Outlet** 8.50 mm,
Refrigerant R134a, **Filling valve** w/o
A: 150.00 **B:** 60.00 mm



260840 Dryer

Replacing: 13277638, 1618654, 8880700314, 95458

Servicing: Opel

Refrigerant R134a, **Filling valve** w/o
A: 353.00 **B:** 33.00 mm



260841 Dryer

Replacing: 3D0820189D, V10-06-0035

Servicing: VW

Inlet 18.00 mm, **Outlet** 18.00 mm,
Refrigerant R134a, **Filling valve** w/o
A: 205.00 **B:** 76.00 mm

NEW PRODUCT
www.hc-cargo.com

260842 Dryer

Replacing: 6455X7, 931280, 931306, 9633622980, 9636622980, 963662980, E164018, 13740153, 33145, 8880700215

Servicing: Citroen

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a
A: 168.00 **B:** 74.00 mm



260843 Dryer

Replacing: 351197241, 80101S9A013, 8847408010, 921921853R, 978022H000, 978023L000, 97853-2D000, DFD41003

Servicing: Hyundai

Inlet 8.50 mm, **Outlet** 8.50 mm,
Refrigerant R134a, **Filling valve** w/o
A: 250.00 **B:** 40.00 mm



260844# Dryer

Replacing: 351196761, 6455Q4, 7006417, 931136, 931318, 96281070, 9628107080, 962810780, E164005, E164157

Servicing: Citroen

Inlet 5/8-18 mm, **Outlet** 5/8 - 18 mm,
Refrigerant R134a, **Filling valve** w/o
A: 142.00 **B:** 75.00 mm



260845 Dryer

Replacing: 64536907403, 6907403, 931434, 13750071, 8880700253, 8FT351198-471, 95327, BWD279, TSP0175438

Servicing: BMW

Refrigerant R134a, **Filling valve** w/o
A: 334.00 **B:** 38.00 mm



260846 Dryer

Replacing: 5003980AA, 5015343AA, K5003980AA, 8FT351200-321, 95365, V33-06-0010

Servicing: Chrysler

Inlet 10.20 mm, **Outlet** 10.20 mm,
Refrigerant R134a, **Filling valve** w/o
A: 165.00 **B:** 71.00 mm



260847 Dryer

Replacing: 04798017, 05066503AA, 05066503AB, 05066635AA, 05066635AB, 05066635AC, 4798017, 5066503AA, 5066503AB

Servicing: Chrysler

Inlet 15.40 mm, **Outlet** 11.70 mm,
Refrigerant R134a, **Filling valve** w/o
A: 172.00 **B:** 60.00 mm



260848 Dryer

Replacing: 921920001R, 946440, 13750094, 8880700305, 8FT351335-241, 95488, RTD431

Servicing: Renault

Refrigerant R134a, **Filling valve** w/o

A: 233.00 **B:** 30.00 mm



260850 Dryer

Replacing: MR167799, 95413

Servicing: Mitsubishi

Inlet 9.80 mm, **Outlet** 9.80 mm,

Refrigerant R134a, **Filling valve** w/o

A: 182.00 **B:** 60.00 mm

NEW PRODUCT
www.hc-cargo.com

260852* Dryer

Replacing: 46848750, DFD09013

Servicing: Lancia



260853 Dryer

Replacing: 6001548601, 8200408985, 509938, 95476, DFD23034, RTD450

Servicing: Renault

Inlet 11.10 mm, **Outlet** 11.10 mm,

Refrigerant R134a, **Filling valve** w/o

A: 173.00 **B:** 60.00 mm



260918 Dryer

Replacing: 30742232, 30780200, 9166174, VOD146, 13750057, 13750080, 33121, 33281, 83810, 8880700198

Servicing: Volvo

Inlet 11.10 mm, **Outlet** 11.10 mm,

Refrigerant R134a, **Filling valve** w/

A: 360.00 **B:** 35.00 mm



260920 Dryer

Replacing: 5K0298403, 5M0298403, 8880700311, 95490, V10-06-0042

Servicing: VW

Refrigerant R134a, **Filling valve** w/o

A: 235.00 **B:** 20.00 mm



260921 Dryer

Replacing: 1J0820191F, 946444, 33296, VWD293

Servicing: VW

Inlet 13.60 mm, **Outlet** 13.60 mm,

Refrigerant R134a, **Filling valve** w/o

A: 160.00 **B:** 60.00 mm



260922 Dryer

Replacing: 1015001020, 351197321, 4B0820193A, 931409, 945453, TSP0175649M, 13740161, 33236, 509704, 8880700275

Servicing: Audi

Inlet 19.50 mm, **Outlet** M28 mm,

Refrigerant R134a, **Filling valve** w/o

A: 205.00 **B:** 88.00 mm



260923# Dryer

Replacing: 30648952, 30780198, 31369544, 13750103, 33305, 8880700315, 8FT351200-361, 95492, WOD153

Servicing: Volvo

Inlet 11.10 mm, **Outlet** 11.10 mm,

Refrigerant R134a, **Filling valve** w/

A: 360.00 **B:** 35.00 mm



260924# Dryer

Replacing: 46804649, 46804655, 931444, 931460, 946432, 13740186, 33195, 509606, 95477, DFD09003, FTD348

Servicing: Fiat

Inlet 11.10 mm, **Outlet** 11.10 mm,

Refrigerant R134a, **Filling valve** w/o

A: 166.00 **B:** 62.00 mm



260925 Dryer

Replacing: 6455FV, 6455GP, 71749801, CND247

Servicing: Peugeot

Refrigerant R134a, **Filling valve** w/o

A: 364.00 **B:** 29.00 mm



260927 Dryer

Replacing: 1140122, 52409884, 8200392916, 8200766008, 8200932916, 13750105, 33322, 8880700290, 95341, RTD453

Servicing: Renault

Inlet 21.40 mm, **Outlet** 21.40 mm,

Refrigerant R134a, **Filling valve** w/

A: 200.00 **B:** 89.00 mm



260945 Dryer

Replacing: 1015001039, 1310196, 1363197, 1466513, 3M5H19E647BA, 3M5H19E647BB, 3M5H19E647BC, 931430, 945499

Servicing: Ford

Inlet 20.60 mm, **Outlet** 17.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 200.00 **B:** 89.00 mm



260946 Dryer

Replacing: 1015001032, 1015001303, 2T1H1647AE, 2T1H1647AF, 5039623, 5083963, 931397, 945582, 9T1H19E647DA

Servicing: Ford

Inlet 20.60 mm, **Outlet** 17.50 mm,
Refrigerant R134a, **Filling valve** w/

A: 203.00 **B:** 89.00 mm



260947 Dryer

Replacing: 1618242, 8FT351198-561, 931400, 931419, 93170609, 945450, 945585, 95557314301, DFD2000, 13740202

Servicing: Opel

Refrigerant R134a, **Filling valve** w/o

A: 375.00 **B:** 30.00 mm

NEW PRODUCT
www.hc-cargo.com

260963* Dryer

Replacing: 97853-2F000, KAD083

Servicing: Kia



260964 Dryer

Replacing: 31274799, 33313

Servicing: Volvo

Inlet 13.70 mm, **Outlet** 13.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 165.00 **B:** 70.00 mm



260965 Dryer

Replacing: 931416, 945570, 97801-38001, 8FT351200-701, 95482, HYD117, TSP0175444, V52-06-0013

Servicing: Hyundai

Inlet M20x1.50 mm, **Outlet** M16x1.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 186.00 **B:** 60.00 mm



260966 Dryer

Replacing: 8K0298403A, 33310, 7110540, 8880700308, 95450

Servicing: Audi

Refrigerant R134a, **Filling valve** w/o

A: 255.00 **B:** 25.00 mm



260971 Dryer

Replacing: 1337496, 1516767, 830001, DFD99180, TSP0175074, 13740055, 33094, 8880700174, 8FT351196-701, 95113

Servicing: Volvo

Inlet 17.40 mm, **Outlet** 8.50 mm,
Refrigerant R134a, **Filling valve** w/o

A: 245.00 **B:** 75.00 mm



260972 Dryer

Replacing: 81.61910.6017, 81.61910.6023, 81.61910.6045, 81619106024, 830016, DFD99161, TSP0175324, 13740193

Servicing: MAN

Inlet 13.80 mm, **Outlet** 13.80 mm,
Refrigerant R134a, **Filling valve** w/o

A: 403.00 **B:** 45.00 mm



260973 Dryer

Replacing: 0008301583, 830010, A0008301583, 13740015, 33294, 8FT351197-411

Servicing: Mercedes-Benz

Inlet 11.80 mm, **Outlet** 11.80 mm,
Refrigerant R124a, **Filling valve** w/o

A: 290.00 **B:** 51.00 mm



260975 Dryer

Replacing: 830007, 98482342, DFD12101, DFD12102, TSP0175062, 13740012, 33140, 8880700150, 8FT351196-171, 95215

Servicing: Seat

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a, **Filling valve** w/

A: 228.00 **B:** 76.00 mm



260976 Dryer

Replacing: 1321891, 945079, DFD99551, TSP0175421, 8FT351192-491

Servicing: Ford

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a, **Filling valve** w/o

A: 123.00 **B:** 52.00 mm



260977 Dryer

Replacing: 1282786, 1356360, 1371366, 1698300, 1782912, 3121464, BTR3717, 33116, 8FT351192-551, 95344, UVD027

Servicing: Peugeot

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a, **Filling valve** w/

A: 203.00

B: 63.00 mm



260978 Dryer

Replacing: 0008301783, 0008301983, 81.61910.0013, 81.61910.6012, 81255036136, 81619106009, 81619106010

Servicing: Mercedes-Benz

Inlet 3/4-16UNF, **Outlet** 3/4 - 16UNF, **Refrigerant** R134a, **Filling valve** w/o

A: 290.00

B: 53.00 mm



260979 Dryer

Replacing: 133545, 1772730, 33315, 8FT351193-221

Servicing: Scania

Inlet 9.00 mm, **Outlet** 8.50 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 173.00

B: 98.00 mm



260980 Dryer

Replacing: 260986, 9708300283, 9738300183, A9708300283, A9738300183, 8880700263, 8FT351197-471, 8FT351198-551

Servicing: Fiat

Inlet 13.70 mm, **Outlet** 13.70 mm, **Refrigerant** R134a, **Filling valve** w/o

A: 200.00

B: 64.00 mm



260981 Dryer

Replacing: 0008302483, 000830248364, A0008302483, A000830248364, 13750098, 8880700262, 8FT351198-541, MED269

Servicing: Chevrolet

Inlet 3/4-16UNF, **Outlet** 3/4-16UNF, **Refrigerant** R134a, **Filling valve** w/o

A: 280.00

B: 50.00 mm



260982 Dryer

Replacing: 1618848, 20490945, 260974, 3176639, 8142079, 830008, DFD33010, DFD33013, TSP0175073, 13740032

Servicing: Volvo

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a, **Filling valve** w/

A: 226.00

B: 75.00 mm



260983 Dryer

Replacing: 0008302083, 0008302983, 830012, A0008302083, A0008302983, DFD17029, TSP0175239, 13740199

Servicing: Mercedes-Benz

Inlet 11.80 mm, **Outlet** 11.80 mm, **Refrigerant** R134a, **Filling valve** w/o
Pressure sensor and pressure valve should to be used from the old filter.

A: 290.00

B: 53.00 mm



260984 Dryer

Replacing: 98343658, 13750107, 8880700304, 8FT351192-441

Servicing: Iveco

Refrigerant R134a, **Filling valve** w/o

A: 435.00

B: 29.00 mm



260985 Dryer

Replacing: 0008301883, A0008301883, 13740148, 8880700261, 8FT351197-451, 95286

Servicing: Mercedes-Benz

Inlet 3/4-16UNF, **Outlet** 3/4-16UNF, **Refrigerant** R134a

A: 51.00

B: 283.00 mm



261012 Dryer

Replacing: 1015001037, 1015001038, 1230579, 1307761, 1307762, 1324677, 1330671, 1362623, 1362624, 1362625

Servicing: Ford

Inlet 20.50 mm, **Outlet** 23.80 mm, **Refrigerant** R134a, **Filling valve** w/

A: 200.00

B: 89.00 mm



261013 Dryer

Replacing: 13277637, 13330220, 1618198, 1618477, 9202688, 9237857, 946437, 13750097, 33342, 8880700301

Servicing: Opel

Refrigerant R134a, **Filling valve** w/o

A: 248.00

B: 24.00 mm



261034 Dryer

Replacing: 7N0898191, VWD331

Servicing: Honda

A: 153.00

B: 45.00 mm

NEW PRODUCT
www.hc-cargo.com

261070* Dryer
Replacing: 92131-JD50B, 95495
Servicing: Nissan

NEW PRODUCT
www.hc-cargo.com

261080* Dryer
Replacing: 96336467, 33150
Servicing: Daewoo

NEW PRODUCT
www.hc-cargo.com

261081* Dryer
Replacing: 1435697, 30776238, 95499
Servicing: Volvo

NEW PRODUCT
www.hc-cargo.com

261137* Dryer
Replacing: 1790603
Servicing: Ford

NEW PRODUCT
www.hc-cargo.com

261140* Dryer
Replacing: 5Q0298403A, 8FT351193-281
Servicing: Audi

NEW PRODUCT
www.hc-cargo.com

261141* Dryer
Replacing: 97853-2F100, 8FT351193-411
Servicing: Kia

NEW PRODUCT
www.hc-cargo.com

261276 Dryer
Replacing: MN902181, UVD125
Servicing: Mitsubishi
Refrigerant R134a
A: 225.00 **B:** 30.00 mm

NEW PRODUCT
www.hc-cargo.com

261277* Dryer
Replacing: 7812A125
Servicing: Mitsubishi



261279 Dryer
Replacing: 1851881, FDD599
Servicing: Ford
Inlet 11.10 mm, **Outlet** 11.10 mm,
Refrigerant R1234yf
A: 286.00 **B:** 32.00 mm



261493 Dryer
Replacing: 20490947, 13750061, 33079
Servicing: Volvo
Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a
A: 226.00 **B:** 76.00 mm

NEW PRODUCT
www.hc-cargo.com

261495 Dryer
Replacing: 5Q0298403, 5Q0298403B, 5Q0298403D, 8880700353, 95598, UVD126
Servicing: Audi
Refrigerant R134a
A: 35.00 **B:** 225.00 mm



261496 Dryer
Replacing: 90486845, 13740019, 33053, 508739, 8880700080, 8FT351195-471, 94228, OLD282, TSP0175017
Servicing: Holden
Inlet 10.50 mm, **Outlet** 10.50 mm,
Refrigerant R134a, **Filling valve** w/o
A: 210.00 **B:** 64.00 mm

NEW PRODUCT
www.hc-cargo.com

261497* Dryer
Replacing: 8200017628, 509590, DFD23024, RTD337, TSP0175321
Servicing: Renault



261500 Dryer
Replacing: 6455X4, 13740050, 33093, 508871, 8880700172, 8FT351196-511, CND185, DFD07005, TSP0175058
Servicing: Citroen
Inlet 5/8-18UNF, **Outlet** 5/8-18UNF,
Refrigerant R134a
A: 180.00 **B:** 76.00 mm

NEW PRODUCT
www.hc-cargo.com

261501* Dryer

Replacing: 645520, 13740178, 509689, 95474, CND203, DFD07006

Servicing: Citroen

NEW PRODUCT
www.hc-cargo.com

261502* Dryer

Replacing: 1S0898191, 8FT351193-211

Servicing: VW

NEW PRODUCT
www.hc-cargo.com

261504* Dryer

Replacing: 1002142, 13740122, 509941, 8FT351192-351, 95353, DFD10022, FDD119, TSP0175220

Servicing: Ford Australia



261506 Dryer


Replacing: 191820191A, 13713315, 33069, 508922, 8880700107, 8FT351195-641, 95106, DFD32005, TSP0175077, VWD169

Servicing: VW

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a, **Filling valve** w/o

A: 135.00

B: 75.00 mm

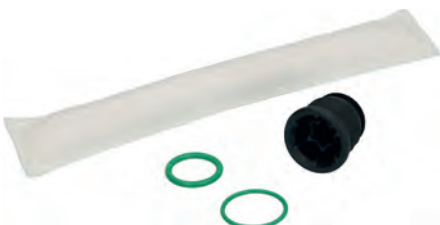

261507 Dryer

Replacing: 4G0298403, 8U0298403, 95554

Servicing: Audi

Refrigerant R134a

A: 220.00

B: 35.00 mm

NEW PRODUCT
www.hc-cargo.com

261509 Dryer

Replacing: 702820191

Servicing: VW

Inlet 10.15 mm, **Outlet** 10.15 mm, **Refrigerant** R134a

A: 75.00

B: 200.00 mm



261510 Dryer

Replacing: 645524, 9637860380, 13740152, 33146, 509401, 8880700173, 8FT351196-751, 95204, CND186, DFD07010

Servicing: Citroen

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a

A: 74.00

B: 60.00 mm

NEW PRODUCT
www.hc-cargo.com

261511 Dryer

Replacing: 4759072, 13740157, 33139, 509567, 8880700130, 8FT351196-011, 95187, DFD25001, SBD044, TSP0175166

Servicing: Saab

Inlet 8.50 mm, **Outlet** 8.50 mm, **Refrigerant** R134a

A: 60.00

B: 215.00 mm

NEW PRODUCT
www.hc-cargo.com

261514* Dryer

Replacing: 7700272486, 13740026, 508616, 8FT351197-341, DFD23001, RTD370, TSP0175028

Servicing: Renault

NEW PRODUCT
www.hc-cargo.com

261515* Dryer

Replacing: 1744538, 8FT351193-581

Servicing: Ford Australia



261517 Dryer


Replacing: 6455R1, 13740006, 33022, 508597, 8FT351195-251, CND234, DFD07001, TSP0175045

Servicing: Citroen

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a

A: 240.00

B: 51.00 mm

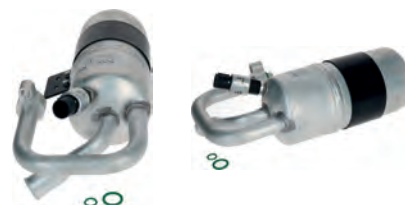

261520 Dryer

Replacing: 1335953, 13750063, 33339, 8FT351335-121, 95505, FDD386

Servicing: Ford

Inlet 17.60 mm, **Outlet** 20.60 mm, **Refrigerant** R134a

A: 202.00

B: 89.00 mm

NEW PRODUCT
www.hc-cargo.com

261523* Dryer

Replacing: 7700272433, 13740025, DFD23003

Servicing: Renault

NEW PRODUCT
www.hc-cargo.com

261524 Dryer

Replacing: 88471-12020, 88471-12060, 33327, 8FT351195-271

Servicing: Mitsubishi

Inlet 8.70 mm, **Outlet** 8.70 mm, **Refrigerant** R134a

A: 60.00

B: 187.00 mm

NEW PRODUCT
www.hc-cargo.com

261525* Dryer

Replacing: 97801-22000, 97801-22001, Z0015242B, Z0015-242C, Z0015242D, Z0015-242G, 813178, 8FK351003-281

Servicing: Porsche

NEW PRODUCT
www.hc-cargo.com

261526* Dryer

Replacing: 73411-SA000, SUD089

Servicing: Subaru

NEW PRODUCT
www.hc-cargo.com

261527* Dryer

Replacing: 5202206, 95571

Servicing: Ford

NEW PRODUCT
www.hc-cargo.com

261528* Dryer

Replacing: 6455R9, 9323870280, 9611746280, 33068, 8FT351196-261, PED303, TSP0175021

Servicing: Peugeot



261529 Dryer

Replacing: 1408300283, A1408300283, 13740170, 33165, 8880700077, 8FT351196-951, 95076, DFD17009, MSD668

Servicing: Mercedes-Benz

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a

A: 195.00

B: 75.00 mm



261530 Dryer

Replacing: 1268300383, A1268300383, 13740014, 33027, 8880700013, 8FT351195-301, 95077, DFD17007, MSD007

Servicing: Mercedes-Benz

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a, **Filling valve** w/o

A: 170.00

B: 75.00 mm

NEW PRODUCT
www.hc-cargo.com

261532* Dryer

Replacing: 6025107659, 13740065, 33057, 8880700329, 8FT351195-691, DFD23010, TSP0175030, UVD031

Servicing: Renault



261533 Dryer

Replacing: 1248300183, 1248300383, A1248300183, 13713359, 33026, 8880700011, 8FT351195-201, 95023, MSD003

Servicing: Mercedes-Benz

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a

A: 170.00

B: 75.00 mm

NEW PRODUCT
www.hc-cargo.com

261535* Dryer

Replacing: 1408300183, A1408300183, 13740109, 33033, 8FT351196-301, 95076, DFD17008, MSD266, TSP0175053

Servicing: Mercedes-Benz



261536 Dryer

Replacing: 6453P6, 6453Z0, 13740060, 33029, 8880700065, 8FT351195-461, 95060, CND202, TSP0175050

Servicing: Citroen

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a

A: 215.00

B: 64.00 mm

NEW PRODUCT
www.hc-cargo.com

261537* Dryer

Replacing: 64531389048, 33019, 8880700006, 8FT351195-581, DFD05010, TSP0175188

Servicing: BMW

NEW PRODUCT
www.hc-cargo.com

261539* Dryer

Replacing: 7222750, 13740130, 33091, 8880700203, 8FT351195-721, DFD10017, FDD297, TSP0175113

Servicing: Ford



261540 Dryer

Replacing: 60590126, 33041, 8880700138, 8FT351195-661, DFD01004, TSP0175003

Servicing: Alfa Romeo

Inlet 5/8-18UNF, **Outlet** 5/8-18UNF, **Refrigerant** R134a

A: 145.00

B: 76.00 mm

